

MC3065 DMM Module is not recognized by the M300 mainframe


The Rigol MC3065 DMM module is designed for use with the Rigol M300 switch/DMM data acquisition system.

If the MC305 module is not recognized, there are a few steps that can help to isolate the cause of the problem.


1. Check the MC3065 connector for obstructions and remove them, if applicable
2. Check the M300 slot for obstructions and remove them, if applicable
3. Re-insert the MC3065 into the slot and check for recognition
4. If the MC3065 module is not recognized, check the fuse (AC250V F3.5M) located on the back panel.. replace it if it is damaged or missing:



To check for recognition of any module, press Utility > Detect. This will open up the module test window.

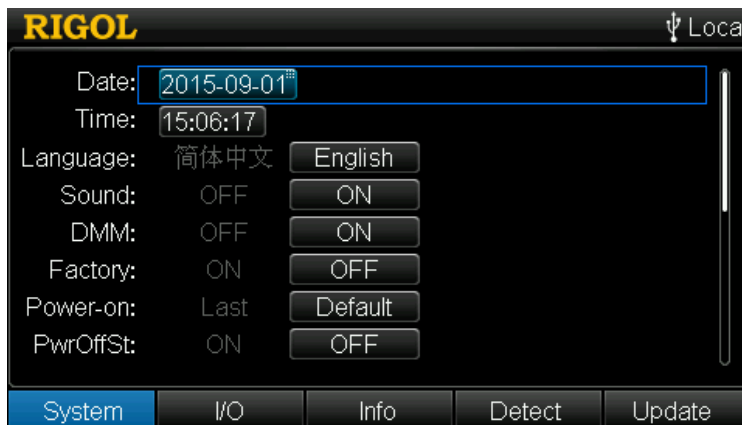

If everything is correct, it should appear as below:

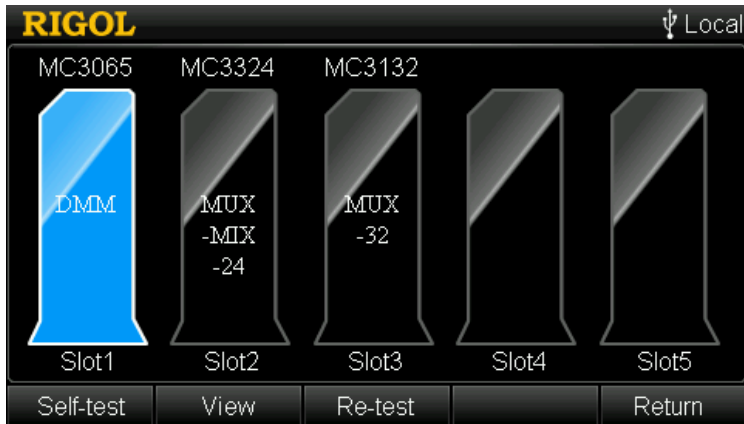

Find more information online [M300 Family Information page](#)

For more information on our data acquisition or other products please go to rigolna.com or contact us directly at applications@rigoltech.com or call us toll free at **877-4-RIGOL-1**.

Rigol Technologies USA

10200 SW Allen Blvd, Suite C

Beaverton, OR 97005

877.474.4651